



1. ดับเบิลคลิก MOT2FMEMNIC.exe

คลิก "Discovery" <sup>๒</sup> ตีเลือก BSC10


ตีเลือกทั้ง 2 อัน "Mode-ID protection" กับ "Status Protection" จากนั้น คลิก **File**

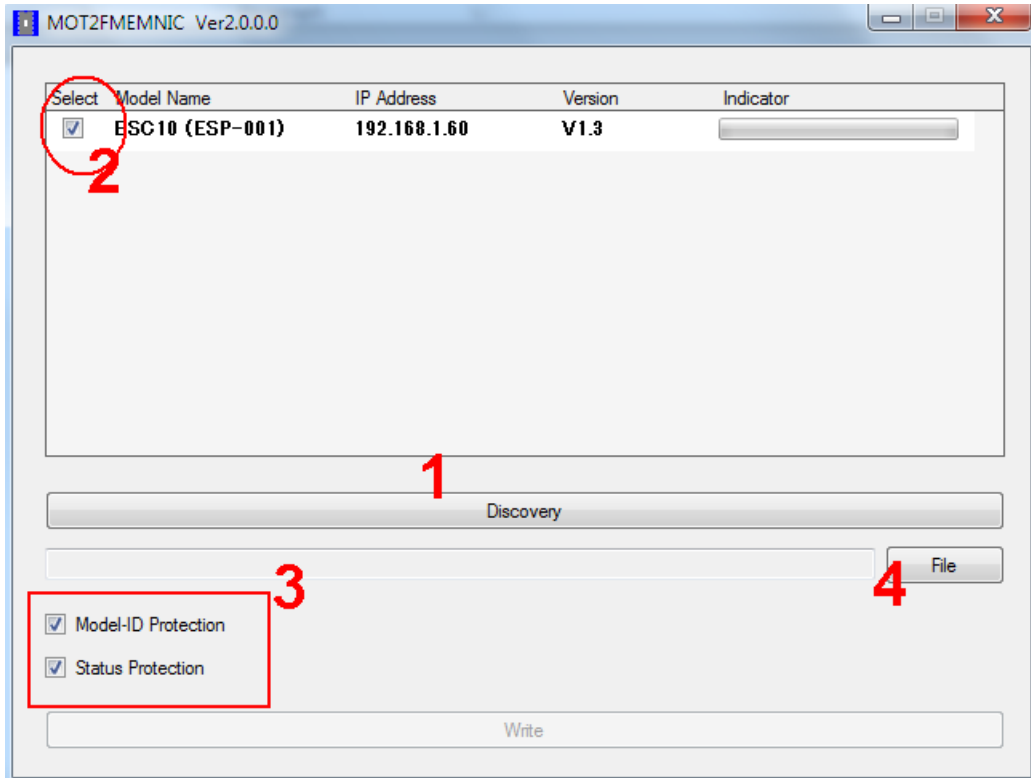

2. เลือกไฟล์ firmware “**BSC10E\_V13\_170726(Main).mot**” จากนั้น คลิก Open


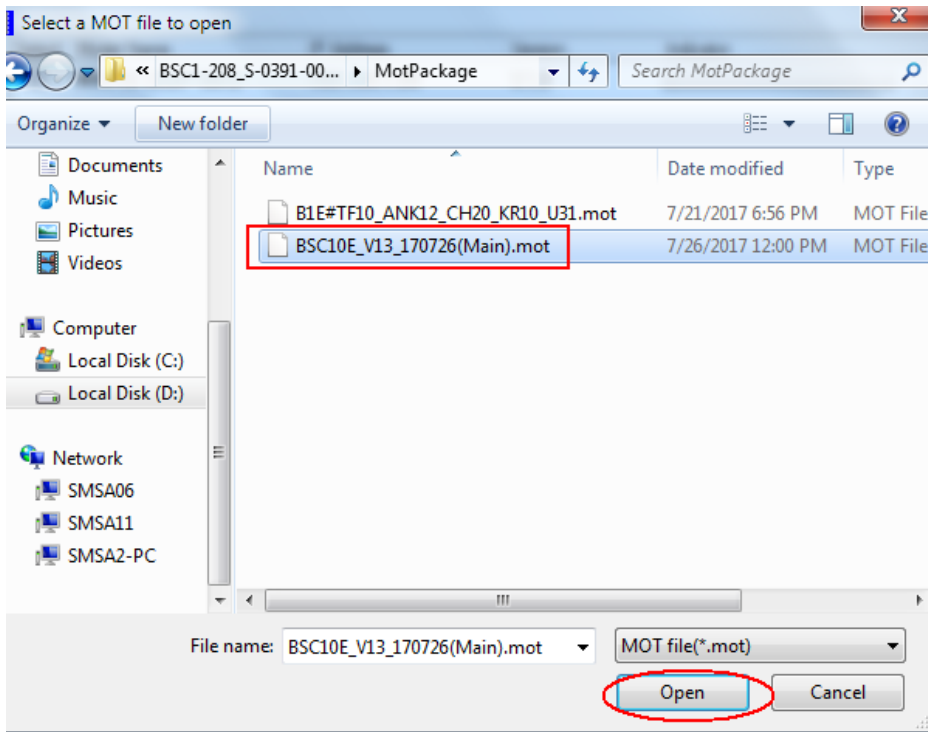


3. จากนั้น กด **Write**

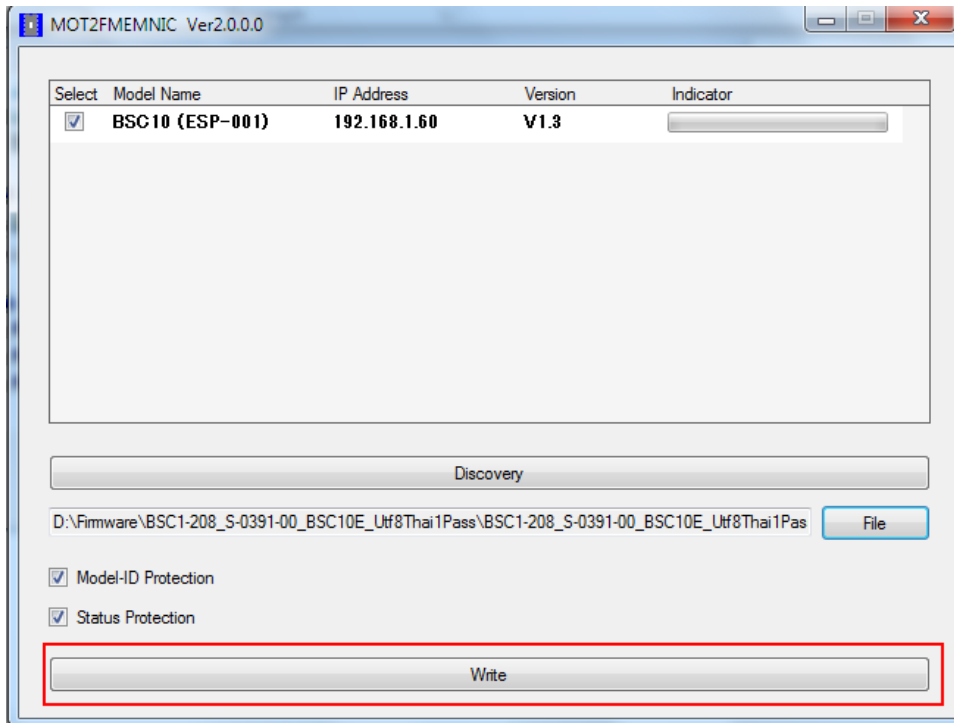



# วิธีอัปเดตเฟิร์มแวร์ของเครื่องพิมพ์รุ่น BSC10E ให้รองรับ Thai UTF-8

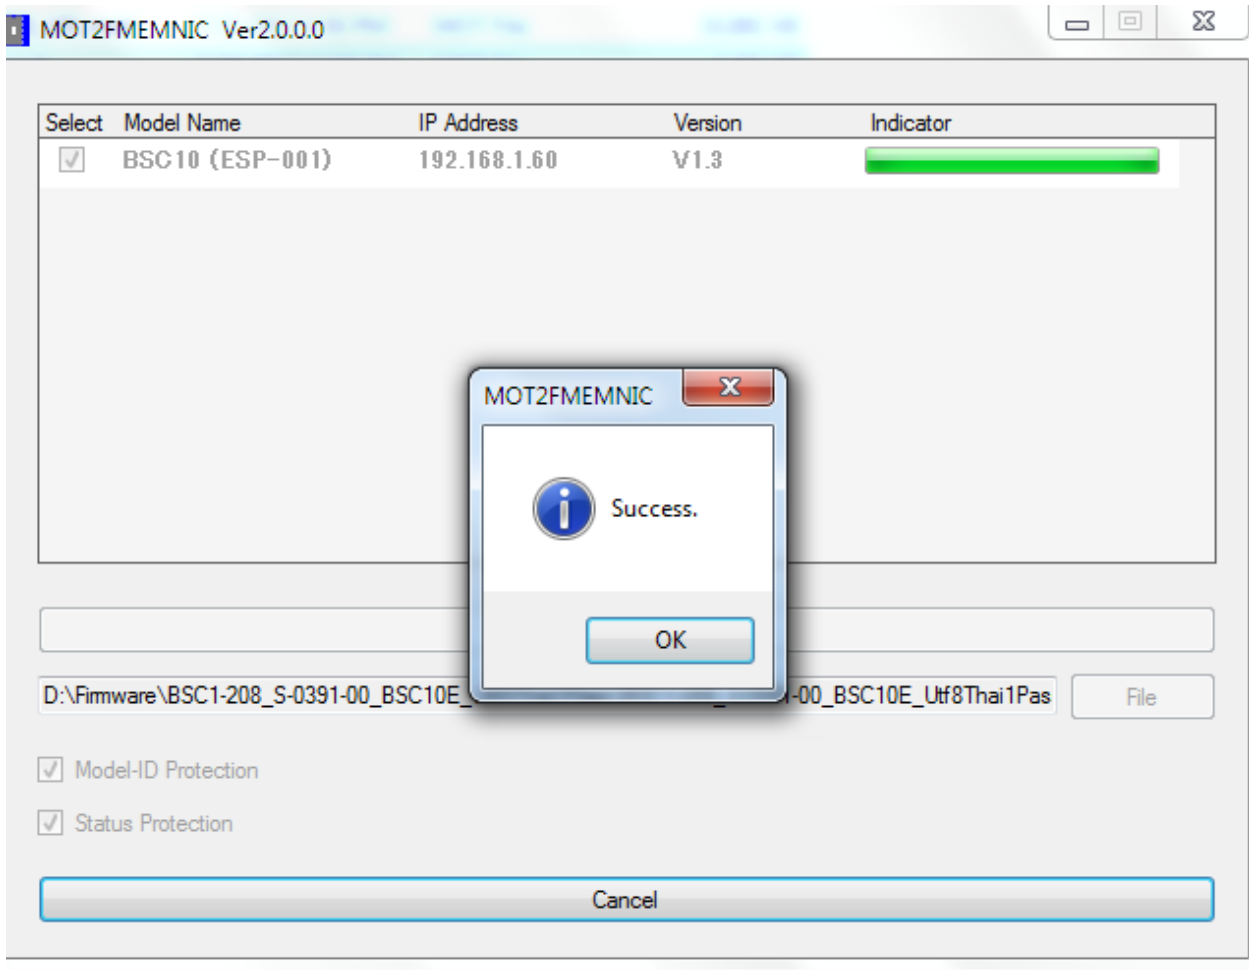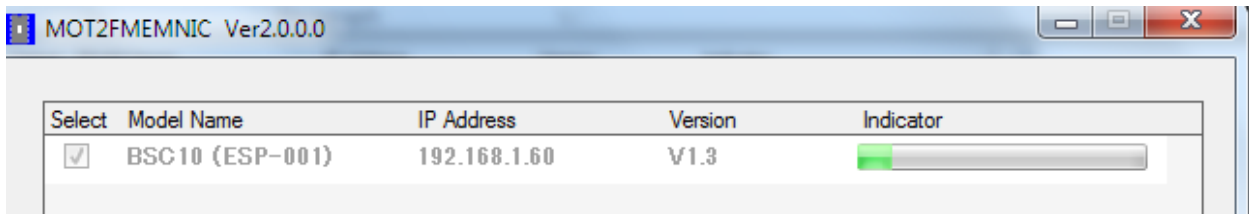


รอเครื่องพิมพ์อัปเดตเสร็จ จะมีไฟสีเขียวติดค้าง

## Re-write Font (ห้ามลิม)


1. ดับเบิลคลิก MOT2FMEMNIC.exe

คลิก "Discovery" ตีเลือก BSC10



ไม่ต้องติ๊ก "Mode-ID protection" กับ "Status Protection" จากนั้น คลิก File

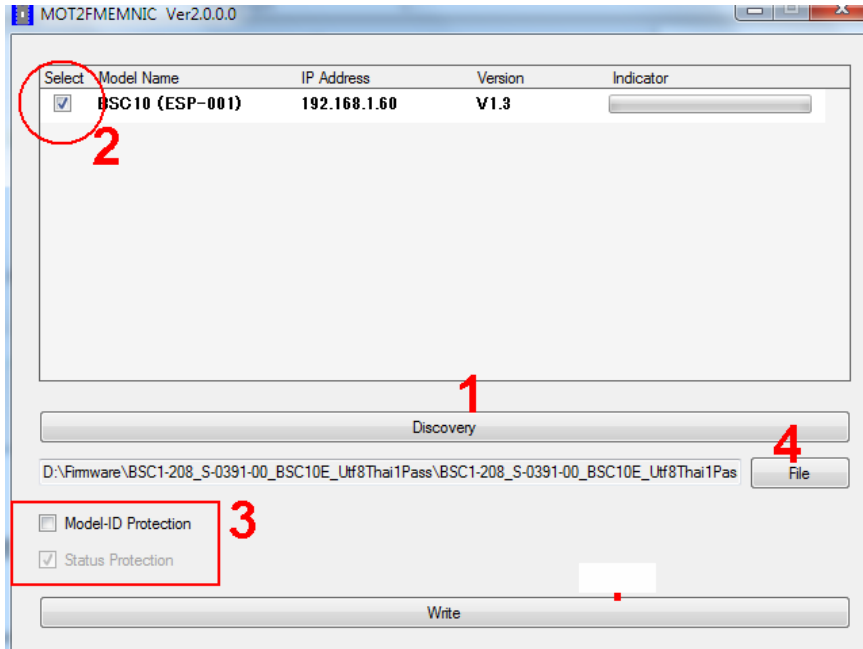

2. เลือกไฟล์ firmware "B1E#TF10\_ANK12\_CH20\_KR10\_U31.mot" จากนั้นคลิก Open

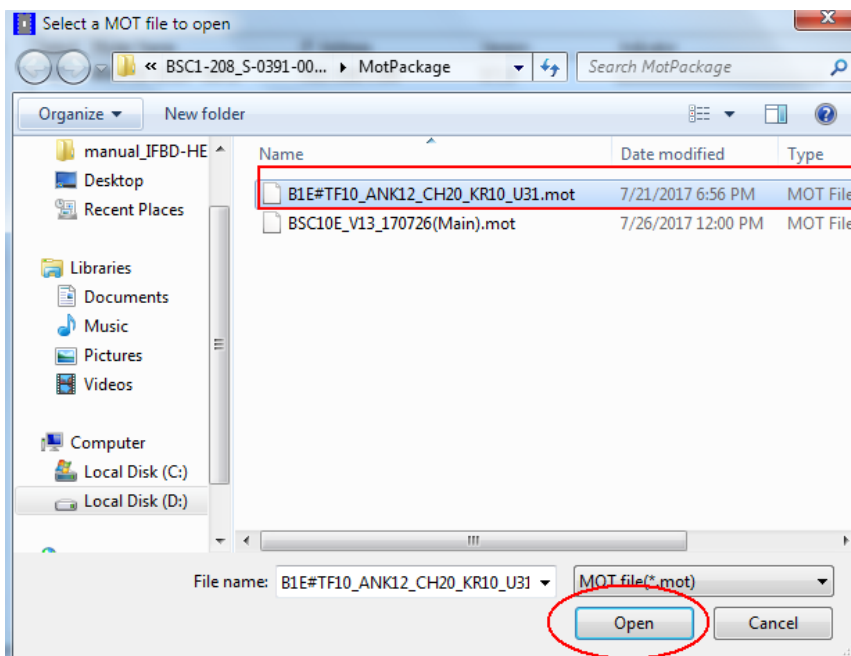


3. จากนั้นคลิก **Write**

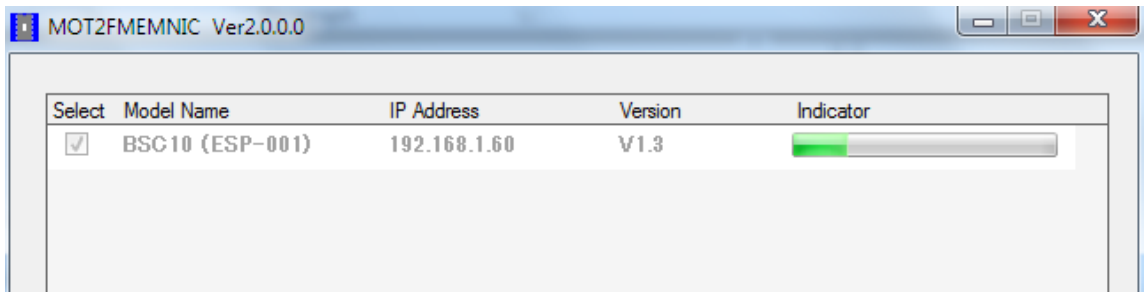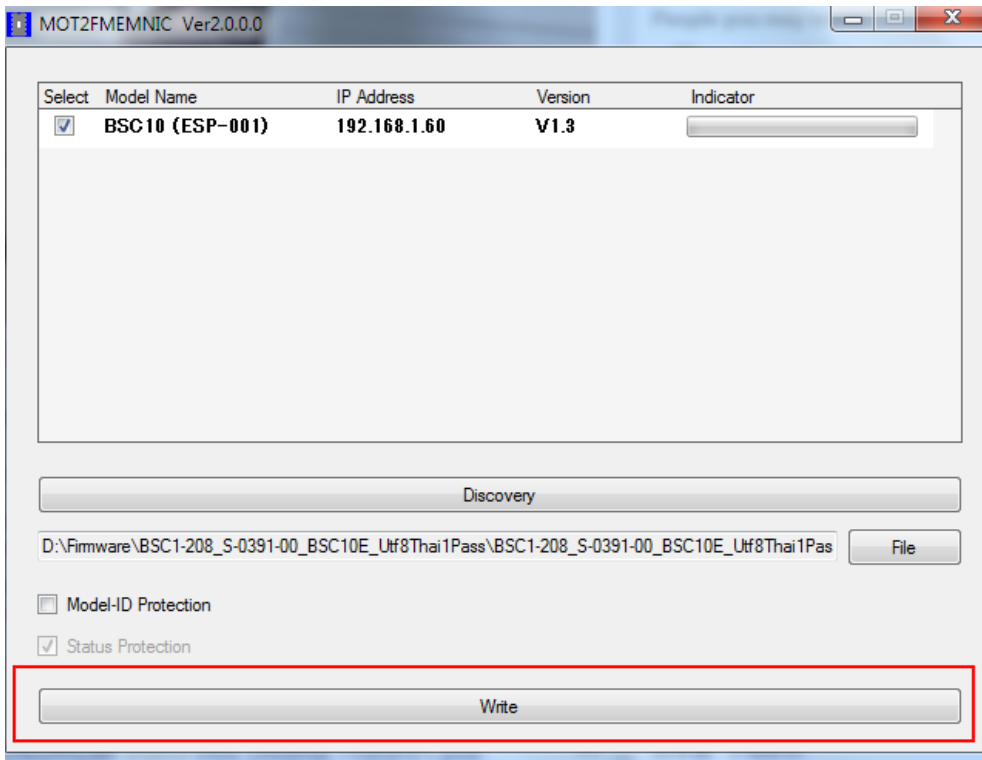



# วิธีอัปเดตเฟิร์มแวร์ของเครื่องพิมพ์รุ่น BSC10E ให้รองรับ Thai UTF-8

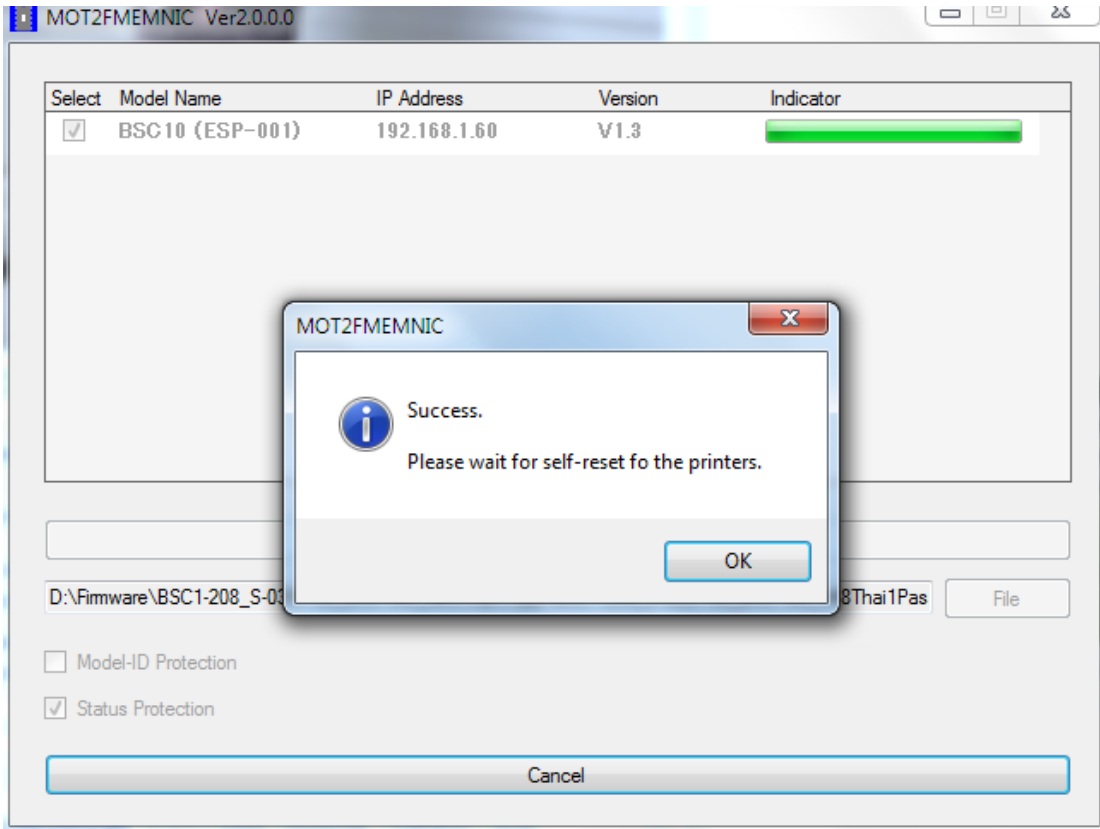



# วิธีอัปเดตเฟิร์มแวร์ของเครื่องพิมพ์รุ่น BSC10E ให้รองรับ Thai UTF-8

กรุณาตรวจสอบโดยการทดสอบการพิมพ์ (self-test)

Firmware version ต้องเป็น " BSC10LAN Ver1.3 170726-b1.3 "

และ Character Mode: Standard - U31

\*\*\* BSC10 LAN Ver1.3 170726-b1.3 \*\*\*

-- Memory Switch --

	FEDCBA9876543210	HEX.
<0>	0000001000000000	0200
<1>	0000000000000000	0000
<2>	0000000000000000	0000
<3>	0000000000000000	0000
<4>	0000000000000000	0000
<7>	0000000000000000	0000
<8>	0000000000000000	0000

-- Memory Switch Detail --

<0>4 = Character Mode: Standard -U3.1  
<1>9 = Top Margin: Default  
<1>7 = Large Font: Valid  
<2>C = 180 Rotation: Invalid  
<2>A = Print Start Control: Line  
<2>5,4 = Print Speed: Normal  
<2>2-0 = Print Density: Standard  
<4>C = Motion Unit: Dot by dot  
<4>4 = Character/Line: ESC/POS  
<4>2-0 = Printable Area: 72mm  
<7>C = ASB: Valid  
<7>4 = BUSY: All  
<8>F-C = H-Reduced Size: Invalid  
<8>B-8 = V-Reduced Size: Invalid